



21 Diagnostic adapters SCA

Diagnostic adapter SCA

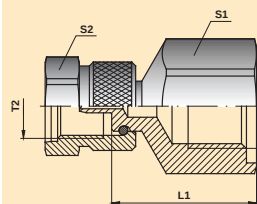


Diagnostic adapters

Order code	PN	Pmax	Pburst	T1	T2	L1	S1	S2
SCA-1/4-EMA-3	630 bar	1,200 bar	2,000 bar	1/4" BSPP	M16x2	32	27	22
SCA-1/2-EMA-3	630 bar	800 bar	1,200 bar	1/2" BSPP	M16x2	36	30	22
SCA-1/2-EMA-3-HP	630 bar	1,200 bar	2,000 bar	1/2" BSPP	M16x2	36	32	22

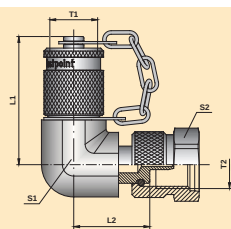


90° diagnostic adapter with measuring coupling


Order code	PN	Pmax	Pburst	T1	T2	L1	L2	S1	S2
SCA-90-EMA-3	630 bar	800 bar	1,200 bar	M16x2	M16x2	52	28.5	19	22

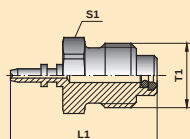


SCA-EMA-3/1

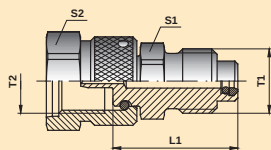

SCA-EMA-3/2

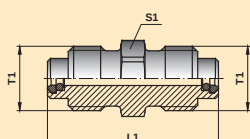

SCA-EMA-3/3

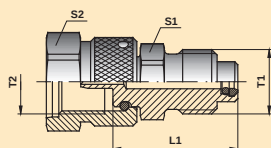

SCA-EMA-3/4

Diagnostic coupling

Order code	PN	Pmax	Pburst	T1	T2	L1	S1	S2
SCA-EMA-3/1	630 bar	800 bar	1,200 bar	M16x2	—	37	17	—
SCA-EMA-3/2	630 bar	800 bar	1,200 bar	M16x2	M12x1.65	31	17	22
SCA-EMA-3/3	630 bar	800 bar	1,200 bar	M16x2	M16x2	43	17	—
SCA-EMA-3/4	630 bar	800 bar	1,200 bar	M16x2	M16x1.5	31	17	22




Note pressure ranges!

Adapters may only be used in connection with products listed in this catalog.




21 Diagnostic adapters SCA

Technical data and order codes

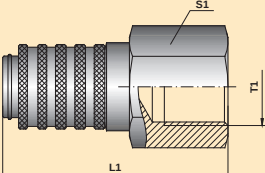

SCA-1/2-PQC

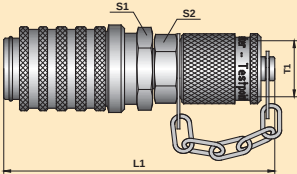

SCA-EMA-3/PQC

Parker diagnostic quick-connection coupling

Order code	PN	Pmax	Pburst	T1	L1	S1	S2
SCA-1/4-PQC	400 bar	600 bar	1,000 bar	1/4" BSPP	—	—	—
SCA-1/2-PQC	400 bar	600 bar	1,000 bar	1/2" BSPP	59	27	—
SCA-EMA-3/PQC	400 bar	600 bar	1,000 bar	M16x2	78	21	17



Note pressure ranges!

Adapters may only be used in connection with products listed in this catalog.

